

Technical Data Sheet

Pressure / Temperature / Humidity / Air Velocity / Airflow / Sound level

KISTOCK DATALOGGER KCC 320 / KPA 320

CE

Temperature / Humidity / Atmospheric pressure / CO₂

KEY POINTS

- Software for configuration and data visualisation freely downloadable
- Software for configuration and data processing available in option
- · Safety lock wall mount with inviolability system
- Storage capacity of 2 000 000 points
- Fast data downloading: 18 000 points/s
- Up to 4 recordable parameters simultaneously
- 2 configurable setpoint alarms for each channel
- 2 lines LCD screen
- Bluetooth® communication for smartphones and tablets (Android and IOS)
- · Magnetic mounting
- IP 40 protection





REFERENCES

Device reference	Display	Internal sensor		External sensor			
		Number	Туре	Number	Туре	Parameters	Number of record points
KCC 320	Yes	4	Temperature, humidity, atmospheric pressure, CO ₂	_		Temperature, humidity, atmospheric pressure, CO ₂	2 000 000
KPA 320		3	Temperature, humidity, atmospheric pressure	-		Temperature, humidity, atmospheric pressure	2 000 000

HOUSING

Dimensions

110.2 x 79 x 35.4 mm

Weight

KCC 320: 206 g KPA: 200 g

Display

2 lines LCD screen

Dimensions of screen: 49.5 x 45 mm 2 indication LEDs (red and green)

Control

1 OK key

1 Selection key

Material

Compatible with food industry environment ABS housing

Battery power supply

2 lithium double AA 3.6 V batteries

Protection

IP 40

PC communication

1 micro-USB input

Environmental conditions of use

Air and neutral gases

Hygrometry: in non-condensing

condition

Maximum altitude: 2000 m

TECHNICAL FEATURES

	KCC 320	KPA 320			
Units displayed	°C, °F, %RH, hPa, ppm	°C, °F, %RH, hPa			
Resolution	0.1°C, 0.1°F, 1 ppm, 0.1%RH, 1 hPa	0.1°C, 0.1°F, 0.1%RH, 1 hPa			
External input	Micro-USB female connector				
Input for probe	-	-			
Internal sensor	Humidity, temperature, atmospheric pressure, CO ₂	Humidity, temperature, atmospheric pressure			
Overpressure tolerated	-	1260 hPa			
Type of sensor	Temperature and humidity: capacitive Atmospheric pressure: piezoresistive CO ₂ : NDIR	Temperature and humidity: capacitive Atmospheric pressure: piezoresistive			
Measuring range	Temperature: from -20 to 70°C Humidity: from 0 to 100%RH Atmospheric pressure: from 800 to 1100 hPa CO ₂ : from 0 to 5000 ppm	<u>Temperature:</u> from -20 to 70°C <u>Humidity:</u> from 5 to 95%RH <u>Atmospheric pressure:</u> from 800 to 1100 hPa			
Accuracies*	Temperature: ±0.4°C from 0 to 50°C ±0.8°C below 0°C or above 50°C Humidity**: ±2%RH from 5 to 95%, 15 to 25°C Atm. pressure: ±3 hPa CO ₂ : ±50 ppm ±3% of the reading	Temperature: ±0.4°C from 0 to 50°C ±0.8°C below 0°C or above 50°C Humidity**: ±2%RH from 5 to 95%, 15 to 25°C Atm. pressure: ±3 hPa			
Setpoints alarms	2 setpoints alarms on each channel				
Frequency of measurements	From 1 minute to 24 hours (15 s in on-line mode)	From 1 second to 24 hours			
Operating temperature	From 0 to +50°C				
Storage temperature	From -40 to +85°C				
Battery life	3 years***	7 years***			
European directives	2011/65EU RoHS II; 2012/19/EU WEEE; 2014/30/EU EMC; 2014/35/EU				

^{*} All accuracies indicated in this document were stated in laboratory conditions and can be guaranteed for measurement carried out in the same conditions, or carried out with calibration compensation.

RECORDER FUNCTION

5 recording modes

KISTOCK can record in 5 different ways:

- "Immediate" mode records values according to a predefined interval.
- "Minimum", "Maximum" and "Average" record automatically the calculation of minimum, maximum or average of measured values during an interval of recording.
- "Monitoring" mode allows to get an accurate history report during error events to help troubleshooting, without stopping the measurement logging. To proceed this way, you just have to define:
- a record interval to be used whilst the readings are beyond the setpoints.
- a record interval for the values measured during each reading beyond the setpoints.

Furthermore, you can also let your KISTOCK record non-stop ("loop" recording option).

4 types of dataset start

Once your recording mode has been set, you can launch your dataset :

- · With a delayed start (with predefined date and time)
- With the software
- · With push-button
- With "Online" option. In this case, your datasets are directly sent, saved and displayed on your PC in real time.

6 types of dataset stop


You can stop your dataset :

- · According to a date and time (if it was started the same way)
- According to a period
- According to a predefined number of recording points
- · Once the storage capacity is full
- · With "Stop" option of the software
- . By holding "OK" key during 5 seconds, if this function has been previously activated by the software

PC CONNECTION Micro-USB connector

^{**} Factory calibration uncertainty: ±0.88%RH. Temperature dependence: ±0.04 x (T-20) %RH (if T<15°C or T>25°C)

^{***} On the basis of 1 measurement each 15 minutes at 25°C.

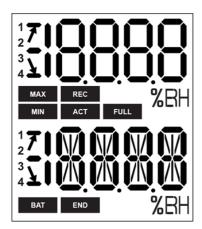

END DATASET is finished.

Indicates that one value is being recorded.

It flashes: the DATASET did not start already.

FULL Flashing slowly: DATASET is between 80 and 90 % of the storage capacity. Flashing quickly: DATASET is between 90 and 100 % of the storage capacity. Constant: storage capacity full.

BAT Constant: indicates that the batteries have to be replaced.

ACT Screen actualisation of measured values.

MIN

MAX

The displayed values are the maximum/minimum values recorded for the channels displayed.

Indicates the alarm action type: rising or falling action.

Temperature in °Celsius.

Temperature in °Fahrenheit .

Relative humidity.

Indicates the channel number which ismeasuring.

SOFTWARE



KILOG LITE: free software to download on the KIMO website (kimo.fr). Allows the data download (graphics and points statement) and the datalogger configuration.



- Configuration and data processing software KILOG software allows to configure, save and process your data in a very simple way.
- Software only: Ref. KILOG-3-N
- Complete set: software + 1 USB cable, Ref. KIC-3-N

SAFETY LOCK WALL MOUNT WITH PADLOCK



- > Mount the safety lock support on the required place.
- $\textbf{1.} \ \textbf{Present the KISTOCK datalogger on the support} \ \textbf{starting with the inferior part}$
- 2. Clip the KISTOCK on the support by falling back the superior part
- 3. Insert the padlock to ensure the safety lock function




The padlock can be replaced by a fail-safe sealed

The datalogger can be placed on the screw-mount without the safety lock function


> To remove the datalogger from the support, proceed on reverse order.

MOUNTING

The KISTOCK class 320 have a magnetic mounting, so you can fix it easily.

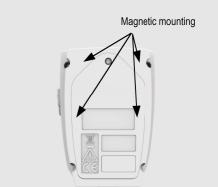

DIMENSIONS OF THE WALL MOUNT (in mm)

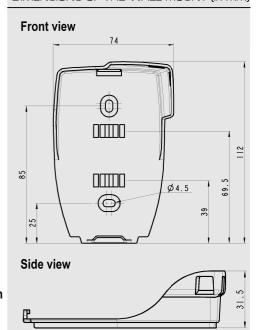

Part numbers	Illustrations
KBL-AA	
KAV-320	
KRB-320	
KNT-320	0.25
CK-50	D
KDC	A SMA
	KBL-AA KAV-320 KRB-320 KNT-320 CK-50



Only the accessories supplied with the device must be used.

CALIBRATION

A calibration certificate is available as option in paper format. We recommend to carry out a yearly checking.

MAINTENANCE

Please avoid any aggressive solvent.

Please protect the device and probes from any cleaning produce containing formalin, that may be used for cleaning rooms and ducts.

GUARANTEE PERIOD

KISTOCK dataloggers have 1-year guarantee for any manufacturing defect (return to our After-sales service required).

PRECAUTIONS FOR USE

Please always use the device in accordance with its intended use and within parameters described in the technical features in order not to compromise the protection ensured by the device.

REPLACE THE BATTERIES



With 3 to 7 years* of battery life, the KISTOCK devices guarantee long-term measurements.

To replace the batteries:

- Unscrew the screw on the back side of the KISTOCK, on the battery hatch, with a cross-headed screwdriver.
- Remove the hatch and the old batteries.
- Insert the new batteries and respect the
- Replace the battery hatch and screw it.

* On the basis of 1 measurement each 15 minutes at 25°C.



BE CAREFUL! Material damages can happen, so please apply the precautionary measures indicated.



Once returned to KIMO, required waste collection will be assured in the respect of the environment in accordance to guidelines relating to WEEE.

www.kimo.fr

Distributed by:



EXPORT DEPARTMENT

Tel: +33. 1. 60. 06. 69. 25 - Fax: +33. 1. 60. 06. 69. 29

e-mail: export@kimo.fr



Uw distributeur Hitma B.V.

Vragen over handmeters: www.hitma-handmeters.nl